


TO BE INSTALLED AND/OR USED IN ACCORDANCE WITH APPROPRIATE ELECTRICAL CODES AND REGULATIONS

If you are not sure about any part of these instructions, consult a qualified electrician.

TO INSTALL:

WARNING: TO AVOID FIRE, SHOCK, OR DEATH; TURN OFF POWER AT CIRCUIT BREAKER(S) OR FUSE(S) AND TEST THAT POWER IS OFF BEFORE WIRING! **NOTE:** Use this device with copper, copper-clad, or aluminum wire.

1. Remove retaining screw and slide off plastic cover.
2. Remove knockout in bottom plate for wall mounting, or in back plate for floor mounting.
3. Mount fixed half of strain relief to metal plate, floor or wall next to removed knockout, using (short) machine screws provided.

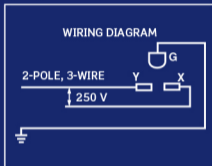

4. Feed conductors through knockout hole. Strip wire leads to 11/16" (strip gauge on base). Rotate terminal clamp/screw assembly 180° and insert conductors into terminal channels. Rotate clamp/screw assembly back over conductor and insert clamp into slot in terminal. Tighten terminal screws to 25 inch pounds.

NOTE: Connect GREEN grounding conductor to GREEN screw terminal and all other conductors into remaining BRASS terminals.

5. Fit loose half of strain relief clamp around conductors and secure to fixed half of clamp using (long) machine screws provided.
6. Mount outlet on floor or wall using 3 (three) wood screws.
7. Slide plastic cover over wired device and secure with retaining screw.
8. Restore power at circuit breaker(s) or fuse(s). Installation is complete.